


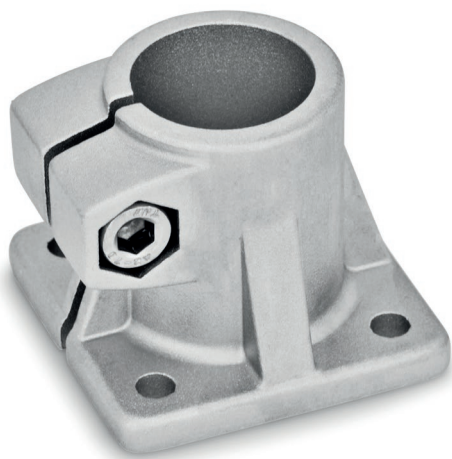

PRODUCT INFO


Base clamps BS of die-cast aluminum have a slitted clamping point machined by cutting methods.

The base flange with four bores serves as an interface or for fastening the clamp to the place of use.

The bore at the clamping point is arranged perpendicular to the face of the flange. It receives typically available construction tubes with full surface contact over the entire cross-section of the bore.

At the screw point, a hex socket cap screw reduces the bore cross-section for clamping.

RoHS-compliant product

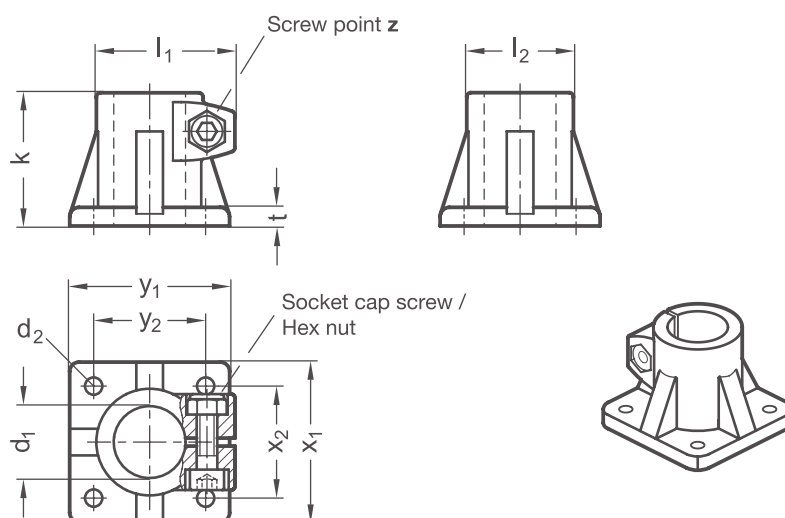

Clamping point										
Bore d₁	Clamping length k	d₂	l₁	l₂	t	x₁	x₂	y₁	y₂	Hex socket cap screw
B 20	50	6,5	52	40	7	60	42	60	42	M 8-25
B 25	50	6,5	52	40	7	60	42	60	42	M 8-25
B 30	50	6,5	52	40	7	60	42	60	42	M 8-25
B 30	70	8,5	68	56	10	90	64	90	64	M 10-35
B 32	70	8,5	68	56	10	90	64	90	64	M 10-35
B 35	70	8,5	68	56	10	90	64	90	64	M 10-35
B 40	70	8,5	68	56	10	90	64	90	64	M 10-35
B 40	85	11	77,5	65	14	105	74	105	74	M 10-50
B 42	85	11	77,5	65	14	105	74	105	74	M 10-50
B 45	85	11	77,5	65	14	105	74	105	74	M 10-50
B 48	85	11	77,5	65	14	105	74	105	74	M 10-50
B 50	85	11	77,5	65	14	105	74	105	74	M 10-50
B 60	100	11	92	80	14	125	89	125	89	M 10-50

Screw point

Z

1	Hex socket cap screw (DIN 912-8.8 and lock nut DIN 985-8, zinc-plated)
2	Hex socket cap screw stainless steel (DIN 912-A2-70 and lock nut DIN 985-A2, glide coating)

Surface

O

2	textured powder-coated, Black RAL 9005
8	blasted, matt

ORDER KEY

BS - d₁ - k - z - o

Base clamp	_____
Clamping point	_____
Clamping length	_____
Screw point	_____
Surface	_____

ON REQUEST

- Clamping point with special diameter
- Screw point with hex head screw
- Surface ball-burnished, anodized or powder-coated in other RAL colors